


DETAIL 1 HEAD

> - MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT. IGU CABLE CONNECTION TO IGU SWC IN HORIZONTAL MULLION. SERVICE LOOP TO BE INSTALLED FOR RE-GLAZING.

DETAIL 2 HORIZONTAL MULLION

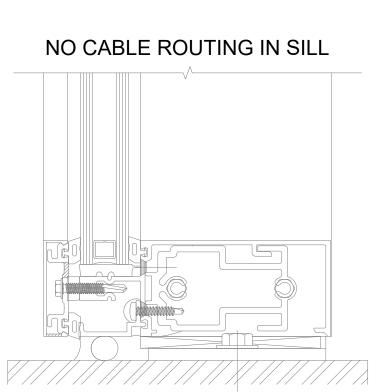


DETAIL 3

CONNECTED.

WHEN GLAZING POCKET CANNOT ACCOMMODATE IGU/SWC, INCORPORATE SERVICE LOOP INTO IGU CABLING. MAKE CONNECTION TO SWC AS YOU ARE GLAZING AND PUSH CONNECTOR THROUGH HOLE

INSTALLER TO PROVIDE GROMMETS

VERTICAL MULLION

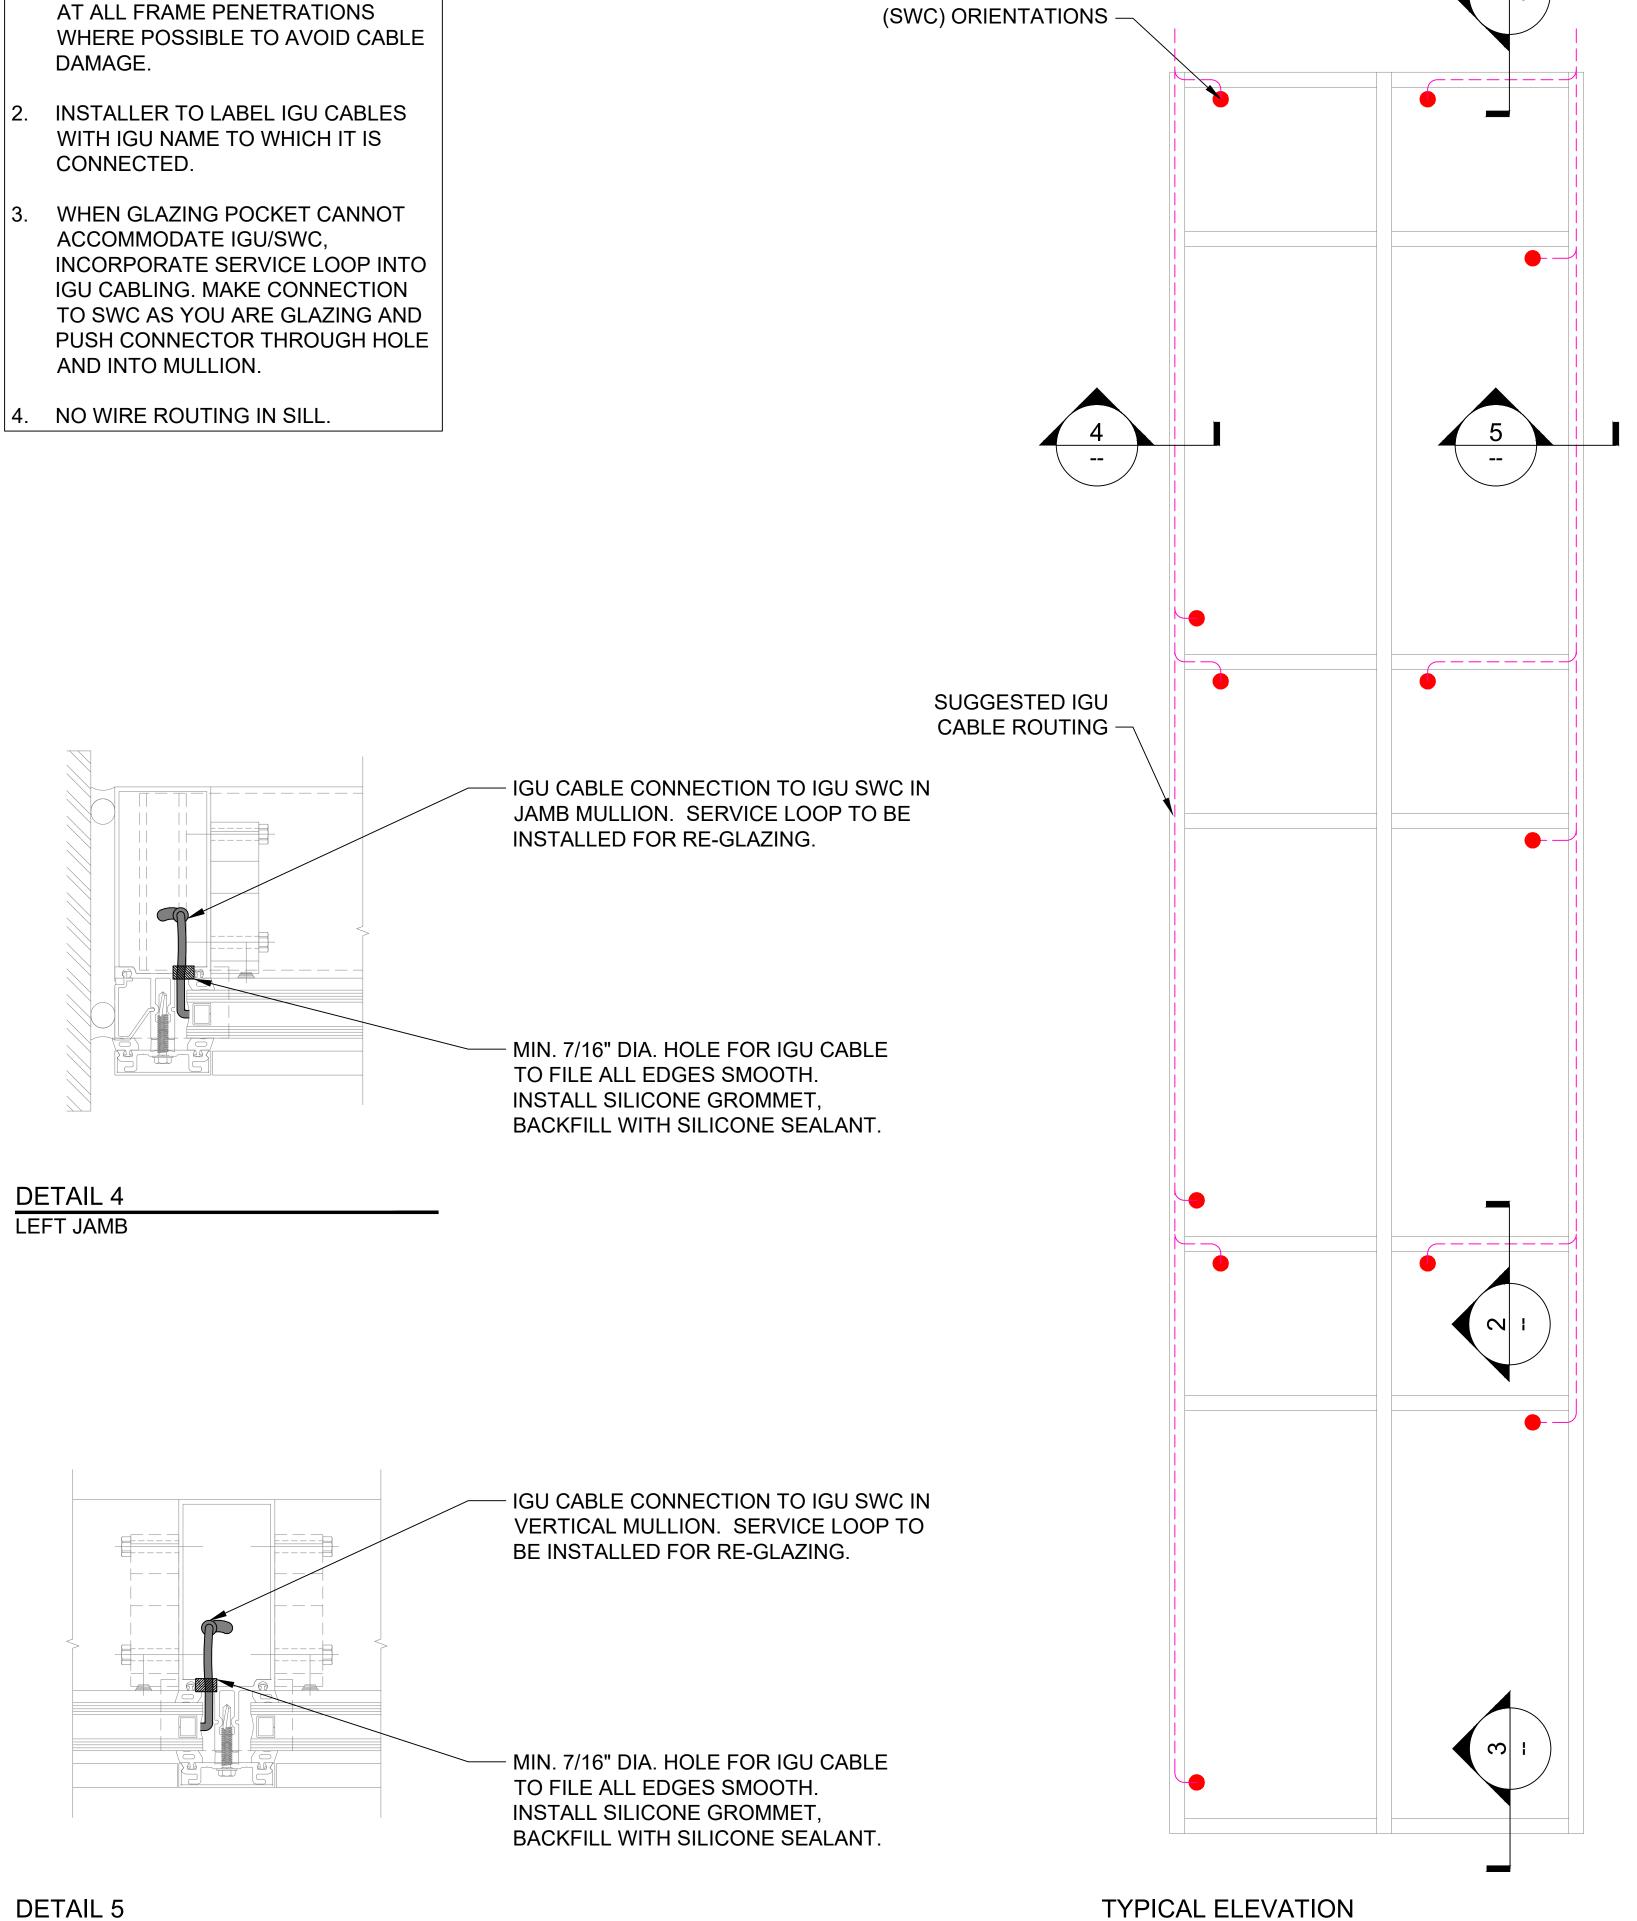

SUGGESTED SMART

WINDOW CONNECTOR

VIEW INC. CONFIDENTIAL: THIS DOCUMENT AND THE INFORMATION CONTAINED IN IT ARE CONFIDENTIAL, AND CANNOT BE COPIED OR DISCLOSED IN WHOLE OR IN PART WITHOUT THE EXPRESS WRITTEN CONSENT OF VIEW, INC.®

view

195 SOUTH MILPITAS BLVD.

MILPITAS, CA 95035

www.viewglass.com

v. 408/263.9200

VIEW, INC.®

INSTALLATION DETAILS: FOR OLDCASTLE - RELLIANCE LT (CW)

SCALE: 1:2

SCALE: NONE