

MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT.

- IGU CABLE CONNECTION TO IGU SWC IN HORIZONTAL MULLION. SERVICE LOOP TO BE INSTALLED FOR RE-GLAZING.

DETAIL 1 HEAD

> — 7/16" DIA. HOLE FOR IGU CABLE TO SWC. FILE ALL EDGES SMOOTH. FILL WITH SILICONE SEALANT.


— 7/16" DIA. HOLES FOR IGU CABLES AT ALL VERTICALS. REQ. (1) PER IGU CABLE. FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET(PREFERRED) FILL WITH SILICONE SEALANT(OPTIONAL).

- IGU CABLE CONNECTION TO IGU SWC IN HORIZONTAL MULLION. SERVICE LOOP TO BE INSTALLED FOR RE-GLAZING.

DETAIL 2
HORIZONTAL MULLION



- INSTALLER TO PROVIDE GROMMETS
 AT ALL FRAME PENETRATIONS
 WHERE POSSIBLE TO AVOID CABLE
 DAMAGE.
- 2. INSTALLER TO LABEL IGU CABLES WITH IGU NAME TO WHICH IT IS CONNECTED.
- MHEN GLAZING POCKET CANNOT ACCOMMODATE IGU/SWC, INCORPORATE SERVICE LOOP INTO IGU CABLING. MAKE CONNECTION TO SWC AS YOU ARE GLAZING AND PUSH CONNECTOR THROUGH HOLE AND INTO MULLION.
- 4. NO WIRE ROUTING IN SILL.

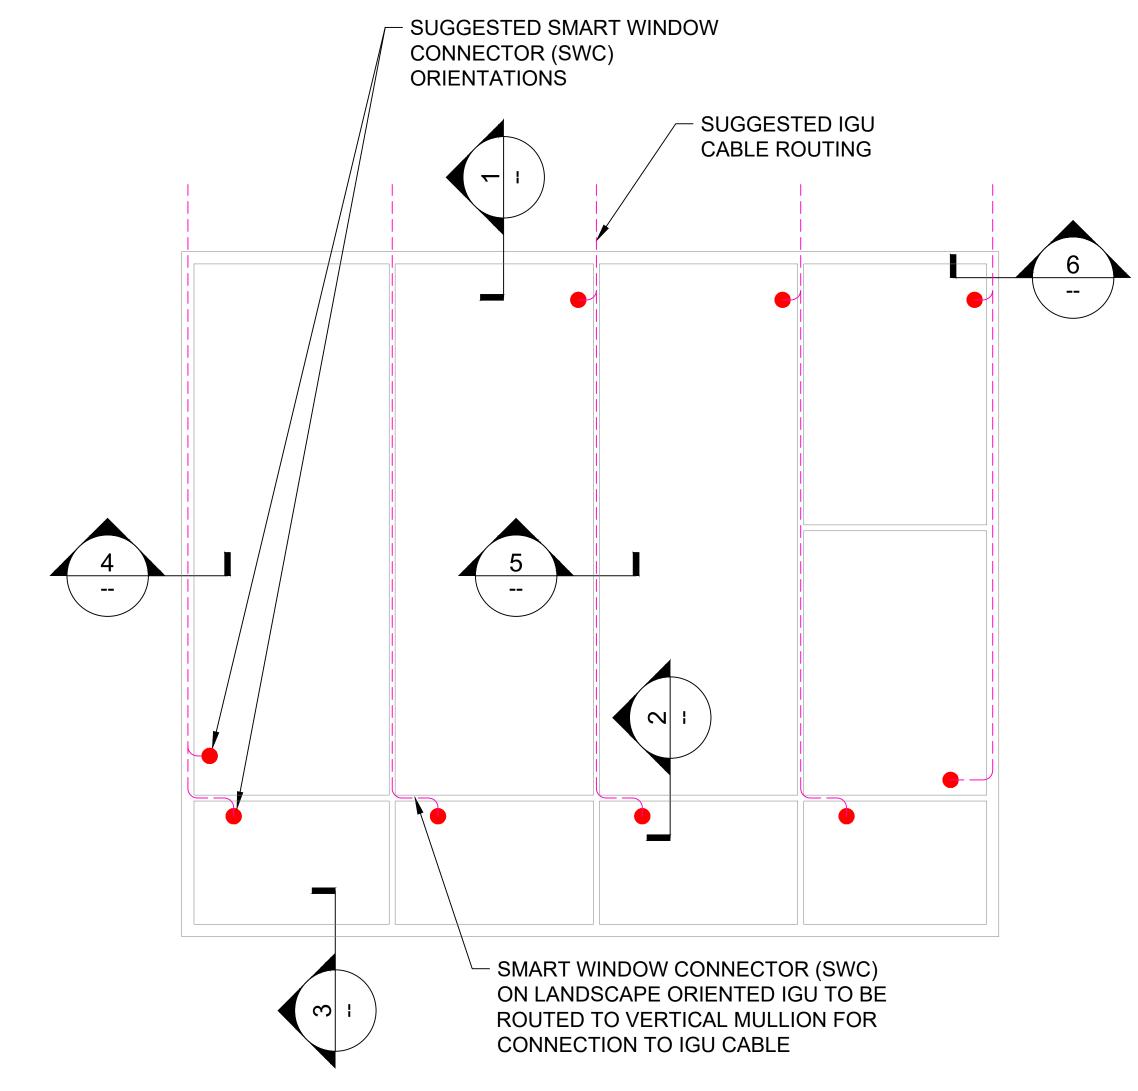

TYPICAL ELEVATION SCALE: NONE

NO CABLE ROUTING IN SILL

CABLE FROM HORIZONTAL

MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT.

IGU CABLE CONNECTION TO IGU SWC IN GLAZING POCKET.

MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT.

IGU CABLE CONNECTION TO IGU SWC IN GLAZING POCKET.

DETAIL 5
VERTICAL MULLION

INSTALLATION DETAILS: FOR OLDCASTLE - SIGNATURE SERIES SGHT (WW)

LEFT JAMB

VIEW INC. CONFIDENTIAL: THIS DOCUMENT AND THE INFORMATION CONTAINED IN IT ARE CONFIDENTIAL, AND CANNOT BE COPIED OR DISCLOSED IN WHOLE OR IN PART WITHOUT THE EXPRESS WRITTEN CONSENT OF VIEW, INC.®

view

195 SOUTH MILPITAS BLVD.

MILPITAS, CA 95035

www.viewglass.com

v. 408/263.9200

VIEW, INC.®

SCALE: 1:2

.: November 6, 2019

DETAIL 3